List 78009 - PHOENIX® PHC: SA/FA
List 78007 - PHOENIX® PHC: SS
List 78008 - PHOENIX® PHC: Bore
List 78006 - PHOENIX® PHC: Bore
List 52603 - PHOENIX® PHC: ASF
List 78015 - PHOENIX® PHC: SF

Work Material		Tensile Strength – Hardness	Milling Speed Vc (SFM)	Insert Size												
				SPMT07...				SDMT09...				SXMT12...				
				Face Milling				Face Milling				Face Milling				
				Feed Per Tooth fz (in/t)	Depth of Cut Aa (in)			Feed Per Tooth fz (in/t)	Depth of Cut Aa (in)			Feed Per Tooth fz (in/t)	Depth of Cut Aa (in)			
					L/D=2	L/D=3	L/D=4		L/D=2	L/D=3	L/D=4		L/D=2	L/D=3	L/D=4	
P	Mild Steels, Carbon Steels (1010, 1018)	~180 HB	590 (195 - 820)	0.028 (0.012 - 0.060)	0.032	0.024	0.016	0.032 (0.012 - 0.071)	0.040	0.032	0.020	0.050 (0.020 - 0.126)	0.047	0.047	0.040	
	Carbon Steels, Alloy Steels (1050, 4140)	~280 HB	590 (195 - 820)	0.028 (0.012 - 0.051)	0.032	0.024	0.016	0.032 (0.012 - 0.060)	0.040	0.032	0.020	0.050 (0.020 - 0.118)	0.047	0.047	0.040	
	Die Steels (H13, D2)	~280 HB	590 (195 - 820)	0.028 (0.012 - 0.051)	0.024	0.020	0.012	0.032 (0.012 - 0.060)	0.032	0.024	0.016	0.050 (0.020 - 0.118)	0.047	0.047	0.040	
M	Stainless Steels (Dry) (304, 420)	~250 HB	525 (265 - 655)	0.016 (0.012 - 0.047)	0.024	0.020	0.012	0.020 (0.012 - 0.060)	0.032	0.024	0.016	0.040 (0.020 - 0.098)	0.047	0.040	0.040	
	Stainless Steels (Wet) (304, 420)	~250 HB	395 (200 - 590)	0.016 (0.012 - 0.047)	0.024	0.020	0.012	0.020 (0.012 - 0.060)	0.032	0.024	0.016	0.040 (0.020 - 0.098)	0.047	0.040	0.040	
K	Cast Iron (FC250)	~350 N/mm^2	655 (330 - 985)	0.032 (0.016 - 0.060)	0.032	0.024	0.016	0.040 (0.020 - 0.071)	0.040	0.032	0.020	0.060 (0.020 - 0.138)	0.060	0.060	0.040	
	Ductile Cast Iron (60-40-18)	~800 N/mm^2	590 (330 - 820)	0.028 (0.012 - 0.051)	0.032	0.024	0.016	0.035 (0.020 - 0.060)	0.040	0.032	0.020	0.053 (0.020 - 0.118)	0.047	0.047	0.035	
S	Heat Resistant Alloys (Inconel 718)	-	100 (85 - 195)	0.012 (0.008 - 0.028)	0.016	0.016	0.012	0.016 (0.008 - 0.032)	0.020	0.020	0.016	0.020 (0.008 - 0.040)	0.040	0.040	0.032	
	Titanium Alloy (Ti-6Al-4V)	-	260 (165 - 395)	0.016 (0.012 - 0.032)	0.016	0.016	0.012	0.020 (0.012 - 0.040)	0.020	0.020	0.012	0.028 (0.012 - 0.047)	0.032	0.032	0.016	
H	Pre-hardened Steel (P20, Stavax)	40 - 43 HRC	395 (130 - 495)	0.016 (0.008 - 0.032)	0.016	0.016	0.012	0.020 (0.008 - 0.040)	0.020	0.020	0.012	0.032 (0.012 - 0.060)	0.040	0.040	0.020	
	Die Cast Steels (A2, S7)	43 - 48 HRC	295 (130 - 395)	0.012 (0.008 - 0.024)	0.016	0.016	0.012	0.016 (0.008 - 0.032)	0.020	0.020	0.016	0.028 (0.012 - 0.047)	0.028	0.028	0.024	
	Hardened Steels (D2)	50 - 55 HRC	195 (130 - 295)	0.008 (0.008 - 0.020)	0.012	0.012	0.008	0.012 (0.008 - 0.028)	0.012	0.012	0.008	0.020 (0.012 - 0.032)	0.020	0.020	0.016	

Maximum Ramping Angle (E) & Helical Angle (P)

Insert Size	SPMT07…				SDMT09...				SXMT12…			
Diameter (inch)	Ramping Angle	Helical Milling (inch)		Helical Angle	Ramping Angle	Helical Milling (inch)		Helical Angle	Ramping Angle	Helical Milling (inch)		Helical Angle
D1	E	D0 Min	D0 Max	P	E	D0 Min	D0 Max	P	E	D0 Min	D0 Max	P
0.625	5.9°	0.857	1.211	4.5°	-	-	-	-	-	-	-	-
0.750	3.2°	1.107	1.461	2.3°	-	-	-	-	-	-	-	-
1.000	2.0°	1.607	1.961	1.2°	3.5°	1.409	1.921	3.0°	-	-	-	-
1.250	1.3°	2.107	2.461	0.9°	1.9°	1.909	2.421	1.7°	7.2°	1.713	2.421	6.1°
1.500	-	-	-	-	1.2°	2.409	2.921	1.0°	2.9°	2.213	2.921	2.5°
2.000	-	-	-	-	0.8°	3.409	3.921	0.7°	1.4°	3.213	3.921	1.2°
2.500	-	-	-	-	0.7°	4.409	4.921	0.7°	1.1°	4.213	4.921	0.9°
3.000	-	-	-	-	0.45°	5.409	5.921	0.4°	1.0°	5.213	5.921	0.8°
4.000	-	-	-	-	-	-	-	-	0.7°	7.213	7.921	0.6°
5.000	-	-	-	-	-	-	-	-	0.5°	9.213	9.921	0.35°
6.000	-	-	-	-	-	-	-	-	0.4°	11.213	11.921	0.3°

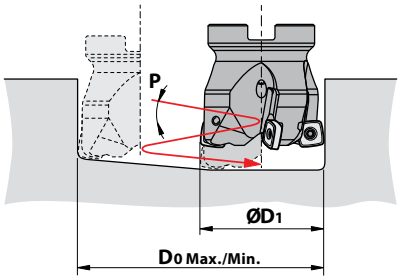

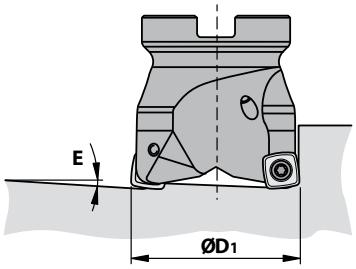

Flute shape definitions for the purpose of creating a program

Insert Size	R (mm)	Aa Max (mm)	rt (mm)	z (mm)
SPMT07...	0.5	0.8	1.2	0.35
SDMT09...	0.8	1	2	0.7
SXMT12...	1	2	3	1.15

For machining purposes, create machining programs for the respective simulated R radius cutters.